



Comp. Limited Kunovice

*Aero*

Company Limited Prague Czechslovakia

---

## MANDATORY BULLETIN No. L 23/024a

Sheet: 1  
Of: 3

**Effectivity:** L 23 Super Blaník sailplanes S/N 938101 - 938104

**Reason:** The mentioned sailplanes are equipped with wing tip extensions which limit the max. allowed speed to 230 km/h IAS. According to LBA, the max. flight speed with the wing tip extensions must be the same as the max. flight

**Description:** speed without them.

The LUN 1106.10-8 airspeed indicators will be replaced with LUN 1106.22-8 ones.

Based on: The requirement of the Airworthiness Authority of the country of importation.

**To be accomplished not later than:** 31<sup>st</sup> May 1995.

**To be accomplished by:** Approved Maintenance Facility.

**Cost covered by:** LET Aeronautical Works, Kunovice.

**Material availability:** The airspeed indicators will be changed „piece for piece“ through the firm AIR-TEC GmbH. The airspeed indicators LUN 1106.10-8 will be sent through the firm AIR-TEC GmbH to LET.

**Validity:** As soon as delivered to the operator.

**Manhours:** 2 man-hours.

.....  
Ing. Fridrich

**Manufacturer**

.....  
Ing. Přihoda

**State Aviation Inspection**

## A. PROCEDURE OF WORK

### 1. Dismantling

Disconnect the hoses supplying static and total pressures to the LUN 1106.10-8 airspeed indicators from the front and rear instrument panels and dismantle the original airspeed indicators. Cut off the heads of 4 rivets of the labels with inscription "MAXIMALE GESCHWINDIGKEIT MIT ANSTECBAREN FLUGELENDEN VNE 230 km/h IAS" (Maximum airspeed with wing tip extensions VNE 230 km/h IAS - dvg. No. A770 541N) situated on control panels, remove the labels, deburr the rivet rests to the plane and paint them with black colour.

### 2. Mounting


Install the new supplied LUN 1106.22-8 airspeed indicators in to the instrument panels. Secure the hoses of static and total pressures using a binding wire after the connection of them. Check for airtightness.

### 3. Material required for modification of 1 sailplane:

<u>Pos.</u>	<u>Unit</u>	<u>Qty</u>	<u>Name</u>	<u>Material</u>	<u>Nomenclature</u>
1	ks	2	Airspeed indicator	LUN 1106.22-8	9501 1060
5	kg	0,0079	Wire	0.8 ČSN 426406	1951 1908

## C. ILLUSTRATIONS

Not necessary.

L23/024a	Vypracoval: Straka	Kontroloval: 	Schválil:	List: 2 Listů: 3
----------	-----------------------	---	-----------	---------------------

D. ADDITIONAL DOCUMENTS REQUIRED TO ACCOMPLISH THE BULLETIN

Not necessary.

E. TOOLING REQUIRED

No special tool is required.

F. SPARE PARTS IN THE SERVICE

Not affected.

G. SAILPLANE MASS

Not affected.

H. RECORD IN THE AIRFRAME LOGBOOK

"The replacement of LUN 1106.10-8 with LUN 1106.22-8 airspeed indicators performed."

Date:

Carried out by:

.....

.....

(legible signature)

I. ACCOMPANYING DOCUMENTATION

Perform the exchange of Flight Manual sheets according to L 23/023a Bulletin at the same time with this Bulletin.

L23/024a	Vypracoval: Straka	Kontroloval:	Schválil:	List: 3 Listů: 3
----------	-----------------------	--------------	-----------	---------------------